

## Inspection Field Notes for Former Plastech-Andover Facility

Facility&Address: Former Plastech Engineered Products, Inc.-Andover  
205 Maple Street Extension  
Andover, OH 44003  
ID number: OHD068896778  
Inspector: Frank Zingales (FZ) and Frank Popotnik (FP)  
Date: 6-13-12  
Time: 1130-1245  
Purpose of Inspection: Identify status of facility.  
Sample(s) Taken: No  
Photograph(s) Taken: Yes

### FINDINGS:

Arrived on-site. Observed that the facility was unsecure. Front (northwest corner) of building was open and accessible areas.

Proceeded to north side of facility.

Paint Mix Location #65, North Paint Kitchen (EPA location 1)

- Exterior door open/unsecure and window broken.
- Interior – Paint/solvent related waste present in trench drains and sumps. Waste had a paint/solvent odor. Observed two sumps, each approximately 30" X 30" with 12" and 4"-6" of paint waste, respectively, in bottom.

Room West of Finishing Room 4 (EPA location 2):

- Exterior door open/unsecure.
- One, 55-gallon drum, full, with contents.
- Outside – one, 5-gallon pail with contents.

Molding Location #10 (EPA location 3) and Raw Material Warehouse Location #30:

- Two exterior doors open/unsecure.
- Shop-vac containing used oil.
- Two carbon dioxide fire extinguishers.
- Cardboard and drums of plastic pellets.
- Evidence of vandalism – graffiti on walls.

Proceeded to south side of facility. Gate open/unsecured.

South side of property, exterior building (EPA location 4):

- Door open/unsecure.
- Approximately 12, 5-gallon pails with contents. One pail labeled as Oxidizer 5.1.

Southeast side of property, exterior:

- EPA location 5: Fence gate open/unsecure around 3 transformers (numbers 91780, 91781 and 91782). Labels indicated PCB content <50 ppm. Two transformers were leaking oil at base (91780 and 91781). Evidence of vandalism at electrical panel.
- Wood pallets, plastic packaging and solid waste present.

Molding Location #10 (EPA location 6):

- 1, 55-gallon drum of used oil;  $\frac{3}{4}$  full. Oil on floor.
- Absorbent in trench drains.

Room north of former Paint Line Area (EPA location 7):

- 8, 5-gallon pails and 7, 55-gallon drums (6 steel and 1 plastic) with contents. One plastic drum labeled as Corrosive. Plastic pails labeled as Protecto.
- Evidence of fire at Paint Line Area.

Fluorescent lamps (intact and broken) present throughout facility.


Left site.

**Ohio EPA Photograph Log**  
**Former Plastech-Andover Facility**  
**June 13, 2012**  
**All digital photographs taken by Frank Zingales.**  
**Camera – Canon PowerShot SD1300 IS**

Photo #	Area / EPA Location	Description
1-3	1	Paint Mix Location #65, North Paint Kitchen: Sump with approximately 12" of paint waste in bottom.
4&5	1	Paint Mix Location #65, North Paint Kitchen: Exterior door open/unsecure and window broken.
6&7	Air Abatement	Former Air Abatement System – Exterior perspective view.
8&9	2	Room West of Finishing Room: Exterior door open/unsecure. One, 55-gallon drum, full, with contents.
10-12	3	Molding Location #10 (EPA location 3) and Raw Material Warehouse Location #30: Two exterior doors open/unsecure. Shop vac with oil.
13-15	4	South side of property, exterior building: Door open/unsecure. Approximately 12, 5-gallon pails with contents. One pail labeled as Oxidizer 5.1.
16-25	5	Southeast side of property: Fence gate open/unsecure around 3 transformers (numbers 91780, 91781 and 91782). Label indicated PCB content <50 ppm. Two transformers were leaking oil at base. Evidence of vandalism at electrical panel.
26	Southwest Side	View of open/unsecured gate at southwest side of facility.
27	Southwest Side	View of front of facility (southwest side).
28-30	6	Molding Location #10: 1, 55-gallon drum of used oil; ¾ full. Oil on floor.
31-37	7	Room north of former Paint Line Area: 8, 5-gallon pails and 7, 55-gallon drums with contents. One plastic drum labeled as Corrosive. Plastic pails labeled as Protecto.
38	Paint Line Area	Evidence of fire that occurred at facility.
39-43	1	Paint Mix Location #65, North Paint Kitchen: Sump with approximately 4-6" of paint waste in bottom. View of trench drains containing paint waste.
44-47	Northwest Side	View of front of facility (northwest side). Open and accessible areas.
48		Plastech sign at entrance to Maple Street Extension.



Former Plastech Andover Facility  
205 Maple St. Ext.  
Andover, OH 44003

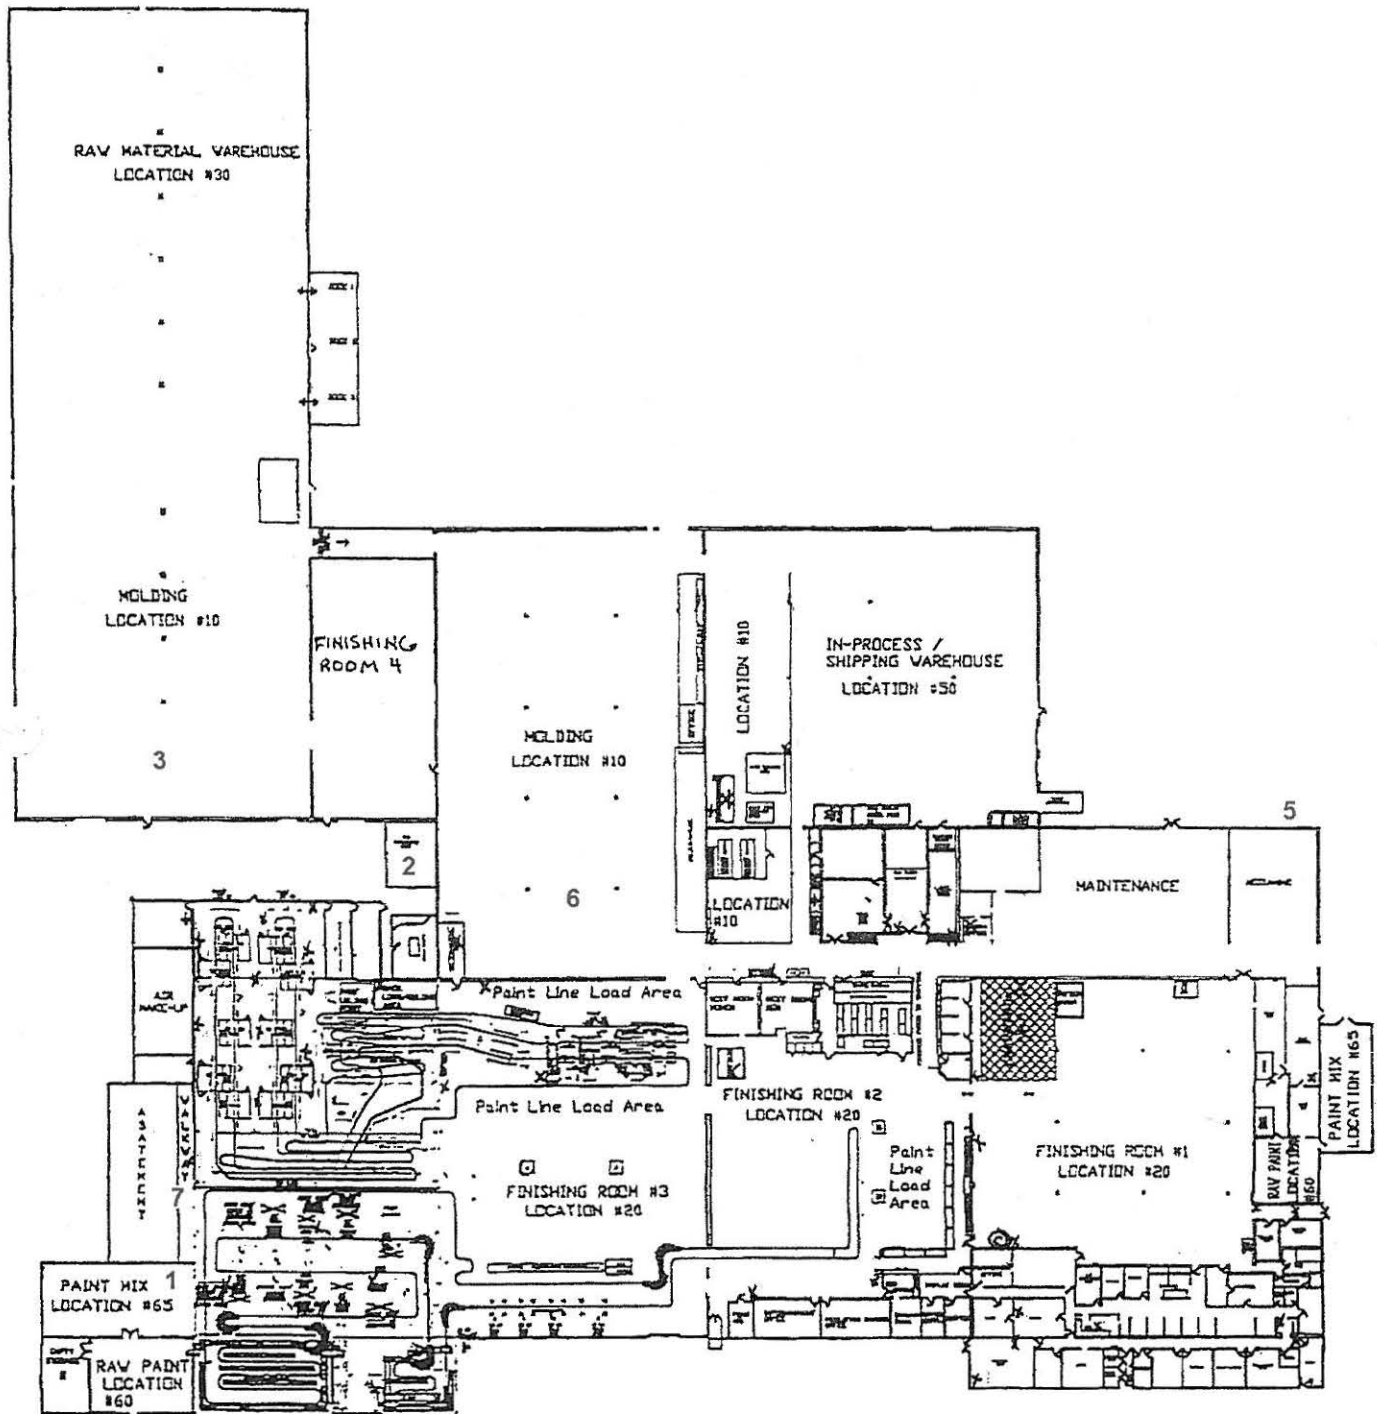





6-13-12 001



6-13-12 002



6-13-12 003



6-13-12 004



6-13-12 005



6-13-12 006



6-13-12 007



6-13-12 008



6-13-12 009



6-13-12 010



6-13-12 011



6-13-12 012



6-13-12 013



6-13-12 014



6-13-12 015



6-13-12 016



6-13-12 017



6-13-12 018



6-13-12 019



6-13-12 020



6-13-12 021



6-13-12 022



6-13-12 023



6-13-12 024



6-13-12 025



6-13-12 026



6-13-12 027



6-13-12 028



6-13-12 029



6-13-12 030



6-13-12 031



6-13-12 032



6-13-12 033



6-13-12 034



6-13-12 035



6-13-12 036



6-13-12 037



6-13-12 038



6-13-12 039



6-13-12 040



6-13-12 041



6-13-12 042



6-13-12 043



6-13-12 044



6-13-12 045



6-13-12 046



6-13-12 047



6-13-12 048